

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

CHILD SEATS:

None during January 2011.

EQUIPMENT:

Baldwin Filters is recalling certain aftermarket oil filters, part number P7405, produced between November 2009 and November 2010, designed for use in large trucks and other large vehicles, specifically for use in two engine models manufactured by Detroit Diesel Corporation (engine models DD13 and DD15). In cold weather conditions, the media in the oil filter fails, causing an adhesive bead to potentially travel into the oil stream and block the flow of oil. This can cause the engine to overheat, resulting in a loss of engine power and/or the causing the crank shaft to fail. Loss of engine power could result in a vehicle crash. Baldwin filters will notify owners of record and replace the P7405 filter with the original equipment filter free of charge. The safety recall began on January 19, 2011. Owners may contact Baldwin Filters Service Engineering at 1-800-822-5394 ext. 79729.

11E-001

Carrier is recalling certain Carrier GenV EM-1 evaporator units (EM-1) manufactured from January 1, 2006 through December 2010, containing a Delphi Pack-Con III fuse holder in an Allied Motion Motor assembly; EM-1 unit part numbers 77-62112-XX and 77-62512-XX, starting with serial number KNT90890232 to serial number NNE91230058, sold as aftermarket equipment and installed as original equipment on certain school and shuttle buses. Due to time, temperature, and/or vibration, the fuse may loosen in the fuse holder resulting in high resistance and arcing. If sufficient arcing occurs, the fuse holder may melt, and may be accompanied by flame, smoke and potential fire. Carrier will notify bus manufacturers, Carrier authorized dealers as well as, to the extent known by Carrier, owners of record which purchased the affected units. Carrier is working with the bus manufacturers and carrier authorized dealers to identify and notify owners of the buses which may have had the affected EM-1 unit sold as original equipment or as an aftermarket installation. Carrier will provide a retrofit kit along with repair instructions free of charge. The safety recall began on January 31, 2011. Owners may contact their vehicle manufacturer or Carrier at 1-800-793-4741.

11E-003

MT&G is working with General Motors to recall certain rear axle cross pins, part numbers 25824249 and ED69145, sold for use as service parts in certain General Motors vehicles. The rear axle cross pins were not properly heat treated and could fracture and become displaced within the rear axle. Should the pin shift out of position, it could create an interference condition and cause the rear axle to lock. The driver may not be able to maintain directional control of the vehicle and a crash could occur without warning. General Motors' dealers will install a new rear axle cross pin free of charge. Owners may contact Cadillac at 1-866-982-2339, Chevrolet at 1-800-630-2438, GMC at 1-866-996-9463 and at the owner center at www.gmownercenter.com.

11E-004

Harley-Davidson is recalling certain accessory kits sold as part number 41000021 for installation on model year 2011 Softail motorcycles. These accessory kits contain body control module (BCM) part number 69993-11. The BCM has a case that may not have been properly sealed during production. An

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

improper seal may allow water intrusion into the BCM which may cause engine stall. An engine stall while in traffic can result in a crash, which could lead to injury or death to the rider. Harley-Davidson will notify owners and dealers will replace the BCM free of charge. The safety recall is expected to begin on or about February 21, 2011. Owners may contact Harley-Davidson at 1-414-343-4056.

11E-005

TIRES:

None during January 2011.

VEHICLES:

TransTech Bus (TCI) is recalling certain MFSAB school buses for failure to comply with the joint strength requirements of Federal Motor Vehicle Safety Standard No. 221, "School Bus Body Joint Strength." The affected buses do not have the proper structural adhesive on certain interior and exterior roof body panel joints. TCI will provide the specific bus models by model year and dates of production once they have determined which buses are affected by the noncompliance. In the event of a vehicle crash the roof panels and joints may not absorb the impact and could open up, increasing the risk of death or serious personal injury to occupants in the event of a crash. TCI is currently developing the remedy for this noncompliance. Owners will be supplied with the parts and instructions on how to repair any affected vehicle(s). TCI will assist all owners with scheduling repairs and locating authorized repair facilities. Any repairs will be performed free of charge. The safety recall is expected to begin on or about February 28, 2011. Owners may contact TCI at 1-845-988-2333.

11V-001

Keystone is recalling certain model year 2010-2011 Cougar, Laredo and Outback travel trailers equipped with Lippert component hitch couplers for lack of indentation on the forward edge of the coupler. If the coupler is lacking the indent it will lead to an increased risk of trailer separation from the hitch ball while towing resulting in property damage and/or vehicle crash. Owners are asked to inspect the hitch coupler for the correct stamping. If the hitch coupler is not formed correctly arrangements will be made to replace it free of charge. The safety recall began on January 24, 2011. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's recall campaign number is 10-156.

11V-002

Ducati is recalling certain model year 2010 MTS 1200S motorcycles. In the event the driver should downshift or maneuver with the clutch disengaged and the engine at idle, the vehicle could stall. Engine stalling could increase the risk of crash. Dealers will re-flash the electronic control unit free of charge. The safety recall began on February 2, 2011. Owners may contact Ducati at 1-800-231-6696.

11V-003

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

Honda is recalling certain model year 2010 Honda Accord and CR-V vehicles. There is a potential failure with the engine wiring harness connector which may cause intermittent spark firing or the engine to stall. An engine stall will increase the risk of a crash. Dealer will inspect and replace the ignition wiring harness connector free of charge. The safety recall began on January 24, 2011. Owners may contact Honda at 1-800-999-1009.

11V-004

Dutchmen is recalling certain model year 2011 Rubicon and Voltage recreational vehicles manufactured between August 16, 2010, through December 23, 2011. The fuel shut-off timer modules are defective. The module was supposed to be programmed with a 5 minute shut-off feature, which automatically shuts off the fuel pump after 5 minutes of no activity. The defective modules do not have this automatic shut-off feature programmed into them. This allows the fuel pump to continuously run if not shut off in the initial 5 minute period, causing it to overheat and fail. Overheating may lead to fire, property damage, or personal injury. Dealers will replace the defective fuel shut-off timer modules free of charge. The safety recall began on January 17, 2011. Owners may contact Dutchmen at 1-574-537-0700.

11V-005

Spartan is recalling certain model year 2008 and 2009 Furion incomplete emergency/rescue vehicles manufactured from November 5, 2007, through August 8, 2009, equipped with Caterpillar C7 engines. The #5 and #6 fuel lines may crack at the fastening point to the common fuel rail and cause a fuel leak. A fuel leak, in the presence of an ignition source, can result in a vehicle fire. Spartan is working with Caterpillar to notify owners and repairs will be performed by authorized Caterpillar dealers free of charge. Owners may contact Caterpillar toll-free at 1-800-447-4986 or Spartan chassis at 1-800-543-5008 Option 5. Spartan's recall campaign number is 11001.

11V-006

General Motors is recalling certain model year 2011 Cadillac Escalade, Escalade ESV, Escalade EXT; Chevrolet Avalanche, Colorado, Express, Silverado, Suburban, Tahoe; and GMC Canyon, Sierra, Yukon and Yukon XL vehicles. The rear axle cross pins were not properly heat treated and could fracture and become displaced within the rear axle. Should the pin shift out of position, it could create an interference condition and cause the rear axle to lock. The driver may not be able to maintain directional control of the vehicle and a crash could occur without warning. Dealers will install a new rear axle cross pin free of charge. The safety recall began on January 11, 2011. Owners may contact Cadillac at 1-866-982-2339, Chevrolet at 1-800-630-2438, GMC at 1-866-996-9463 and at the owner center at www.gmownercenter.com.

11V-007

Daimler Trucks is recalling certain model year 2010 Freightliner Business Class M2 vehicles manufactured from August 25, 2009, through September 3, 2009. These vehicles were built with out of specification inboard seat belt anchor plates that are not as robust as intended. In the event of an a crash, the seat belt anchorage may not continue to hold in place the seat belt apparatus, increasing the risk of the belt not restraining the seat occupant as intended, and increasing the risk of injury to the occupant. Daimler Trucks will repair the vehicles and replace the existing seat belt anchor as necessary free of charge. The safety recall is expected to begin on or before March 11, 2011. Owners may contact Daimler

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

Trucks at 1-800-547-0712. Daimler Trucks' campaign number is FL-587.

11V-008

Fleetwood is recalling certain model year 2010-2011 Southwind and model year 2010 Bounder Class-A motor homes. The LPG tank can come into contact with the spring shackle carrier bolt and damage the LPG tank. The damage has the potential to lead to an unintended release of LPG gas and could result in a fire which may lead to death, injury or loss of the vehicle. Dealers will remove and inspect the propane tank and if necessary, replace the propane tank free of charge. The safety recall is expected to begin during February 2011. Owners may contact Fleetwood RV at 1-800-509-3418.

11V-009

Hino is recalling certain model year 2011 NE8J and NJ8J trucks manufactured from June 1, 2010, through December 10, 2010, and equipped with certain Eaton transmissions with park feature. The reverse idler shaft may contact the park feature and the two components may bind, preventing the park feature from engaging. If a brake is not used or is defective and the park pawl does not engage, the vehicle may be able to move and potentially cause injury to the operator or persons in the vicinity of the moving vehicle or damage property. Hino will notify owners and repair all vehicles that contain this condition free of charge. The safety recall is expected to begin during February 2011. Owners may contact Hino at 1-248-699-9330.

11V-011

DRV is recalling certain model year 2006-2010 Elite, Mobile Suite, and Select Suite recreational vehicles. These vehicles have the incorrect Federal ID tag, gross vehicle weight rating (GVWR) information labels which fails to comply with the requirements of part 567, "Certification." Failure to follow proper vehicle loading specifications because of a misprinted label could increase the risk of a crash. Owners will be provided with new federal id tag information label and installation instructions. The recall is expected to begin during February 2011. Owners may contact DRV at 1-574-457-6472.

11V-012

Hino is recalling certain model year 2011 NJ8J and NV8J heavy trucks manufactured from October 26, 2009, through October 1, 2010. Two of the air lines to the front and rear air tanks may have been installed incorrectly. In the event that the rear tank air pressure was depleted, braking function would be lost and the automatic engagement of the spring brakes will not occur, possibly resulting in a crash. Hino will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin during February 2011. Owners may contact Hino at 1-248-699-9300. Hino's recall campaign number is M0200.

11V-013

Pitts Enterprises is recalling certain model year 2005 through 2008 flatbed tractor trailers, models LT, LP, LB-35, HD-35, TA, and PT, manufactured from august 2004 through October 2008, equipped with the MSQR 5000 differential pressure regulator/quick release valve device manufactured by air brake systems. The MSQR 5000 does not contain the requisite warning light which fails to conform to the requirements of Federal Motor Vehicle Safety Standard No. (FMVSS) 121, "Air Brake Systems." The purpose of the FMVSS for Air Brake Systems, No. 121, is to insure safe braking performance under normal and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

emergency conditions. The MSQR 5000, which was installed in the trailers subject to the recall to satisfy FMVSS No. 121's ABS requirements, does not meet the definition of an abs as required by FMVSS No. 121. Also, the trailers do not have a light to warn the operator of an abs malfunction as required by FMVSS No. 121. Pitts has received no complaints or reports of any onroad failures associated with this noncompliance. Pitts Enterprises will notify owners and dealers will replace the MSQR 5000 system with a compliant system free of charge. The safety recall is expected to begin during February 2011. Owners may contact the sales department of Pitts Enterprises at 1-334-855-4754.

11V-014

Saab is recalling certain model year 2010 and 2011 Saab 9-3 vehicles manufactured from June 2010 through December 2010. Certain fuel pumps installed as original equipment may have internal components with incorrect specifications. The subject fuel pumps can seize causing the engine to stall which increases the risk of a crash. Saab will notify owners and replace the defective fuel pumps free of charge. The safety recall is expected to begin on or about February 18, 2011. Owners may contact Saab at 1-800-955-9007. Saab's recall campaign number is 15029.

11V-015

MCI is recalling certain model year 2010-2011 D4500, D4505, and D4000 motor coaches. The affected pulley covers may lack certain welds required to keep the covers attached to the coach structure. The cover will eventually fail as a result of fatigue, and the cover may become detached from the coach and fall and strike a person or object, resulting in personal injury or property damage. MCI will inspect and replace as necessary the idler pulley covers free of charge. The safety recall began on February 10, 2011. Owners may contact MCI customer service at 1-800-241-2947.

11V-016

Forest River is recalling certain model year 2010-2011 Salem travel trailers manufactured from September 25, 2009, through January 13, 2011. The bottom leaf on the leaf springs may rotate out of position and make contact with the tire. This will cause the tire to blow out without warning and a loss of control of the vehicle resulting in property damage and/or personal injury or death. Dealers will place two square bend "u" bolts with washers and nuts and retaining plate that will be centered on the spring center bolt to restrain the lower spring leaf. This service will be performed free of charge. The safety recall began on February 14, 2011. Owners may contact Forest River at 1-574-389-4600.

11V-017

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Auto Trim Design of Central VA, Inc. on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

please review the list of vehicles provided to us by Auto Trim Design of Central VA, Inc. by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-018

Entegra is recalling certain model year 2010 and 2011 Aspire class a motorhomes manufactured from April 22, 2009, through December 23, 2010 for failing to comply with the requirements of Federal Motor Vehicle Safety No. 108, "Lamps, Reflective Devices, and Associated Equipment." The position of the high beam and low-beam headlamps are transposed from their proper position. Improper height on the headlights may not fully illuminate the road surface or may inhibit the ability of motorists to see vehicles which can increase the risk of a crash. Dealers will disconnect and move the headlamps so that they are in their proper position. This service will be performed free of charge. The safety recall is expected to begin during February 2011. Owners may contact Entegra at 1-800-945-4787.

11V-019

Ducati is recalling certain model year 2006 Multistrada 620, model year 2003-2006, Multistrada 1000, and model year 2007-2009, Multistrada 1100 motorcycles. Fuel leakage can occur at the fuel tank pump flange seal. Fuel leakage, in the presence of an ignition source, could result in a fire. Dealers will replace the fuel pump o-ring with an updated part free of charge. The safety recall began on February 4, 2011. Owners may contact Ducati at 1-800-231-6696.

11V-020

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Galvin Glass on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Galvin Glass by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-021

KZRV is recalling certain towable travel trailers equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. KZRV is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact Norcold at 1-800-767-9101.

11V-022

Great Dane is recalling certain 2007 through 2009 semi-trailer vans equipped with ArvinMeritor TL axles shipped between April 2005 through July 2008. The spindle nut may not have been properly torqued or not torqued at all allowing excessive end-play in the wheel-end system that could progress to a wheel separation. Separation of a wheel from the vehicle will reduce the driver's ability to control the vehicle and could result in a vehicle crash. Great Dane is working with ArvinMeritor to identify owners with the affected axle assemblies. The affected vehicles will be repaired free of charge. The safety recall is expected to begin during February 2011. Owners may contact Great Dane Customer Service at 1-877-369-3493 or ArvinMeritor at 1-248-435-1725.

11V-023

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by AE Sunroofs, LLC on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by AE Sunroofs, LLC by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-024

Think North America is recalling certain model year 2011 think city vehicles for failing to comply with the requirements of Federal Motor Vehicle Safety Standard No. 208, "Occupant Crash Protection." The seat belts may have been incorrectly installed. As a result, a child restraint system used in the passenger seating position may not be positioned or retained properly. The seat belt may not restrain the child as intended during normal vehicle operation or during a crash, increasing the risk of injury. Dealer will inspect, reinstall or, if needed, replace the vehicle's seat belts. This service will be performed free of charge. The safety recall is expected to begin during February 2011. Think's authorized toll free service line at 1-855-698-4465.

11V-025

THINK North America is recalling certain model year 2011 Think City vehicles. Poor performance in the vehicles' fluid heater assemblies could cause the heater-defroster system of the vehicle to fail to perform properly resulting in loss of its ability to clear the windshield in cold or humid conditions. This could impair the driver's ability to view the road ahead, increasing the risk of a crash. Dealers will inspect and, if needed, replace the defroster system free of charge. The safety recall is expected to begin

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

during February 2011. Owners may contact THINK's authorized toll free service line at 1-855-698-4465.

11V-026

Keystone is recalling certain model year 2009-2011, Montana Big Sky and model year 2010-2011, Montana fifth wheel trailers. The propane hose for the slide room may contact the tire and may become damaged as a result. A propane leak, in the presence of an ignition source, could result in a fire and/or explosion causing property damage and/or personal injury. Dealers will install a metal plate to prevent the propane line from coming into contact with the tire. This service will be performed free of charge. The safety recall began on February 1, 2011. Owners may contact Keystone customer service at 1-866-425-4369.

11V-027

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Top Coverage on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Top Coverage by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-028

Toyota is recalling certain model year 2006-2009 Lexus IS and model year 2006-2007 Lexus GS vehicles. Due to insufficient tightening of the fuel pressure sensor connected to an engine fuel delivery pipe with nickel phosphorus plating, there is a possibility that, over time, the pressure sensor could loosen. If loosening occurs, fuel could leak past a gasket used in the connection between the sensor and the pipe and through the threaded portion of the sensor. Fuel leakage, in the presence of an ignition source, could result in a fire. Dealers will inspect for fuel leakage from the threaded portion of the fuel pressure sensor and if a fuel leak is not confirmed, dealers will further tighten the fuel pressure sensor with the proper torque. If a fuel leak is confirmed, the gasket between the sensor and the fuel deliver pipe will be replaced with a new one, and the sensor will be tightened with the proper torque. This service will be performed free of charge. The safety recall is expected to begin during March 2011. Owners may contact Toyota at 1-800-331-4331.

11V-029

Ford is recalling certain model year 1999-2003 Windstar vehicles originally sold in or currently registered in the states of Connecticut, Delaware, the District of Columbia, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New jersey, New York, Ohio, Pennsylvania, Rhode Island, Utah, Vermont, West Virginia, and Wisconsin. A separation of a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

front lower control arm rear attaching bracket may result in a lower control arm separation. A separation of both front subframe rear body mounts may result in separation of the steering intermediate shaft. This could result in reduced steering control increasing the risk of a crash. Dealers will inspect both front lower control arm rear attaching brackets and both body mount attachments at the rear of the front subframe and make the necessary repairs free of charge. The safety recall is expected to begin on or before February 14, 2011. Owners may contact Ford at 1-866-436-7332.

11V-030

Volkswagen is recalling certain model year 2010 New Beetle and New Beetle Convertible manufactured from September 1, 2010, through September 22, 2010, for failing to comply with the barrier test requirements of Federal Motor Vehicles Safety Standards No. 208, "Occupant Crash Protection," that went into effect on September 1, 2010. The vehicles do not meet with requirements that went into effect on September 1, 2010, and therefore may not offer the protection attendant to those requirements. Dealers will offer to replace their vehicle with a comparable vehicle that was produced prior to September 1, 2010, and thus compliant with FMVSS 208 requirements in force until August 31, 2010. The safety recall began on January 28, 2011. Owners may contact Volkswagen at 1-800-822-8987.

11V-031

Strick is recalling certain model year 2006-2009 dry freight vans equipped with ArvinMeritor axles. These vehicles have a defect involving spindle nuts and stake washers which has been identified as low torque on the spindle nut on ArvinMeritor TL series trailer axles installed in van trailers where the stake washer for the nut is staked in a single location as opposed to multiple locations. Low and/or no torque on the nut can result in excessive end-play in the wheel-end system and could progress to a wheel separation which could result in a crash. ArvinMeritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. Please see ArvinMeritor defect report 10E-058. The manufacturer has not yet provided an owner notification schedule. Owners may contact ArvinMeritor at 1-248-273-4641 or Strick at 1-260-692-1334.

11V-032

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Uni-Sun, Inc. on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Uni-Sun, Inc. by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-033

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

Hollandia TVS 900 series sunroofs installed as original equipment by CC Tops on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by CC Tops by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-034

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Koi Wilcox on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Koi Wilcox by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-035

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Webster's Ultimate Performance, LLC's on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Webster's Ultimate Performance, LLC's by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-036

Harley-Davidson is recalling certain model year 2011 Softail motorcycles manufactured from June 7, 2010, through October 8, 2010, which have had a security system kit installed as an accessory. The body

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

control modules (BCM) involved are part numbers 69991-11 and 69993-11. The BCM has a case that may not have been properly sealed during production. An improper seal may allow water intrusion into the BCM which may cause engine stall. An engine stall while in traffic can result in a crash, which could lead to injury or death to the rider. Harley-Davidson will notify owners and dealers will replace the BCM free of charge. The safety recall is expected to begin on or about February 21, 2011. Owners may contact Harley-Davidson at 1-414-343-4056.

11V-037

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Autoextras, LLC on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Autoextras, LLC by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-038

Fairplay is recalling certain model year 2010 and 2011 EVE LSV electric low speed vehicles manufactured from July 31, 2009, through December 27, 2010. A fuse specified to be in the 12V accessory circuit was not built into the wiring harness. The fuse value on the input to the voltage reducer was too large to prevent possible damage. Without this fuse for protection, a short in any portion of the 12V wiring can melt wire insulation and pose the risk of a fire. Fairplay will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin on or about February 17, 2011. Owners may contact Fairplay at 1-866-557-0342.

11V-039

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Don Ritacco & Co. Ltd on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Don Ritacco & Co. Ltd by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

749-8632.

11V-040

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by M&M Automotive on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by M&M Automotive by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-041

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Accessories Unlimited on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Accessories Unlimited by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-042

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Auto Options, Inc. on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Auto Options, Inc. by clicking on the hyperlink affected vehicle list or you

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-043

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Dealer Works on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Dealer Works by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-044

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Texas Auto Tops of Austin on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Texas Auto Tops of Austin by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-045

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Chuck's Tops & Trim, Inc. on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Chuck's Tops & Trim, Inc. by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-046

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Auto Interior Decorations, Inc. on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Auto Interior Decorations, Inc. by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-047

Terex is recalling certain model year 2008-2010 Aerial Device and Digger Derrick utility vehicles manufactured from June, 2008 through November, 2010. The lanyard anchors were not heat treated properly and may fracture. Failure of the lanyard anchor could occur increasing the risk of personal injuries or death. Dealers will replace the lanyard anchors with a new part free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Terex at 1-605-884-3892.

11V-048

Volvo Trucks is recalling certain model year 2011 VNL trucks manufactured from March 23, 2010, through December 22, 2010. There is a potential for the vehicle to start without warning because of an unintended path to ground that exists. This can occur when either the negative battery cable is disconnected at the battery/fusible link or if the fusible link opens as a result of a short circuit. This presents a risk of injury with nonoperational conditions such as when the vehicle is being serviced. Dealers will replace a wiring harness free of charge. The safety recall is expected to begin on or before March 18, 2011. Owners may contact Volvo Trucks at 1-800-528-6586.

11V-050

Navistar is recalling certain model year 2011 Onyx Travel Trailers manufactured from June 18, 2010,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

through September 29, 2010. Under extreme rough road conditions, the suspension equalizer linkages may contact, and possibly damage, brake wiring and/or liquid propane line that are routed above the suspension. Damage to brake wiring may result in a loss of braking ability of the trailer which may lead to a crash possibly resulting in property damage, personal injury, or death. The brake wiring and the liquid propane line will be routed away from the suspension components. This service will be performed free of charge. The safety recall is expected to begin on or about February 28, 2011. Owners may contact Navistar at 1-800-448-7825.

11V-051

Space Craft is recalling certain model year 2006 530 and eV420 space craft recreational vehicles equipped with 1200-Series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Space Craft is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact Norcold at 1-800-767-9101.

11V-052

Coachmen is recalling certain model year 2010-2011 Brookstone trailers equipped with Dometic conventional microwave oven. The conventional microwave oven may not have been installed according to the manufacturers installation instructions. The blower unit should have been rotated to 180 degrees to direct the exhaust out of the front of the conventional oven, prior to installing the appliance. This could present a risk of a fire. Dealers will inspect the conventional microwave oven and if the defect is present, the blower tube will be rotated to comply with the manufacturers instructions. This service will be performed free of charge. The safety recall is expected to begin during February 2011. Owners may contact Coachmen at 1-574-825-8360.

11V-053

Morgan is recalling certain model year 2010 Penske vehicles. The "Z" mounting brackets, which support the van body above the chassis, are subject to bending and, in extreme cases, individually are subject to breaking. If multiple "Z" mounting brackets break, the parcel van body may lower onto the chassis frame rail. The parcel van body touching the frame rail may cause interference between the walk ramp and the fuel line, and may pull away from the chassis cab. Severe overloading could cause the brackets to break increasing the risk of a crash. Dealers will replace all of the "Z" mounting brackets free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Morgan at 1-610-286-2223.

11V-054

Suzuki is recalling certain model year 2009-2010 Suzuki Grand Vitara multipurpose passenger vehicles equipped with 4-cylinder engines; model year 2011 Suzuki Grand Vitara multipurpose passenger vehicles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

produced prior to October 17, 2010; model year 2010 Suzuki SX4 passenger vehicles; and 2011 Suzuki SX4 passenger vehicles produced prior to October 14, 2010. The tension adjuster pulley for the drive belt that operates the alternator, water pump, air conditioner compressor and power steering pump, has an improperly manufactured internal spring that can break due to repeated stress. If the spring breaks, the drive belt will not be adjusted properly and can slip, causing a squeaking noise. Or the drive belt could come off causing the driver to increase to steer the vehicle. This can also cause the coolant temperature indication to rise, which can lead to the engine overheating, or can cause the charging light to come on, which can lead to battery discharge and engine stall. If the drive belt comes off, requiring the driver to use increased steering effort, or the engine stalls, a vehicle crash could occur dealers will replace the tension adjuster pulley with an improved part. This service will be performed free of charge. The safety recall is expected to begin on or before February 16, 2011. Owners may contact Suzuki at 1-887-697-8985 or visit Suzuki's website at <http://www.suzukiauto.com>.

11V-055

Travel Units is recalling certain custom designed recreational vehicles equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Travel Units is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The safety recall is expected to begin during February 2011. Owners may contact Norcold at 1-800-767-9101.

11V-056

Coachmen is recalling certain model year 2009 Georgie Boy Cruise Master Class A motor homes. The fuel-fill cap assemblies used to seal the unused side of the dual-fill gasoline fuel tank were produced with a hose material that did not meet design specifications. During normal usage the hose material may deteriorate which may result in fuel leaks. A fuel leak increases the risk of a fire which may result in property damage, personal injury, or death. Workhorse/Navistar is handling the owner notification and remedy for this campaign. Please see Workhorse/Navistar safety defect report 10V-348. Workhorse/Navistar will replace the original fuel-fill cap assemblies with ones assembled with hose material that meets design specifications. This service will be performed free of charge. Owners may contact Workhorse/Navistar at 1-260-461-1890.

11V-057

Thor Motor Coach is recalling certain model year 2007-2010 Damon Challenger, Model Year 2008-2009 Challenger Platinum, Model Year 2007-2011 Daybreak, Model Year 2010 Daybreak Classic, Model Year 2009-2010 Daybreak Sport, Model Year 2007-2009, Outlaw and Model Year 2011 Four Winds Hurricane, recreational vehicles manufactured from March 2007, through August 2008. The fuel-fill cap assemblies used to seal the unused side of the dual-fill gasoline fuel tank were produced with a hose material that did not meet design specifications. During normal usage the hose material may deteriorate which may result in fuel leaks. A fuel leak increases the risk of a fire which may result in property

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

damage, personal injury, or death. Navistar/Workhorse is handling the remedy and owner notification for this campaign please see Navistar/Workhorse's defect report 10V-348. Navistar/workhorse will replace the original fuel-fill cap assemblies with ones assembled with hose material that meets design specifications. This service will be performed free of charge. Owners may contact Navistar at 1-260-461-1890.

11V-058

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Benefit Auto Service Corp. on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Benefit Auto Service Corp. by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

11V-059

Keystone is recalling certain model year 2011 Avalanche, Laredo, and Springdale recreational vehicles equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Dealers will isolate and perform a drop pressure test on the oven supply tube and if the tube leaks it will be replaced free of charge. The safety recall has started. Owners may contact Keystone Customer Service at 1-866-425-4369. This safety recall campaign is an expansion of a previous recall (Please see 10V-478).

11V-064

Coachmen is recalling certain Model Year 2007-2008 Chaparral, Model Year 2004-2006 Somerset, Model Year 2007-2008 Wyoming, Model Year 2004-2005 Santara, and Model Year 2004-2006 Sportscoach Elite motor homes and fifth wheel trailers manufactured from October 2003, through September 2007. These vehicles are equipped with Dimplex Electraflame, Symphony, or Optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. An overheated receiver could cause a fire. Coachmen is working with Dimplex to identify and notify any affected owners. Dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact Dimplex North America customer service at 1-888-346-7539 or Coachmen Motor Works Customer Service at 1-866-953-5555.

11V-066

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

Newmar is recalling certain model year 2011 Essex DP, King Aire DB, and Mountain Aire DP recreational vehicles manufacturer from October 14, 2009, through November 30, 2010. These vehicles are equipped with V-bus FET-8 control boards manufactured by KIB electronics and there is a potential defect that may result in an unrecognized excessive current situation. This failure may create a shock or fire hazard. Dealers will reprogram the KIB V-bus lighting and control network free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Newman at 1-574-773-7791.

11V-067

Winnebago is recalling certain model year 2008 Destination and Latitude motor homes built on workhouse custom chassis. The fuel fill cap assemblies used to seal the unused fuel tank inlet were produced with an incorrect hose material. A fuel leak increases the risk of a fire which may result in property damage, personal injury or death. Navistar/Workhorse is handling the remedy and owner notification for this campaign please see Navistar/Workhorse's defect report 10V-348. Navistar/Workhorse will replace the original fuel-fill cap assemblies with ones assembled with hose material that meets design specifications. This service will be performed free of charge. Owners may contact Navistar at 1-260-461-1890.

11V-068

Fleetwood RV is recalling certain recreational vehicles equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Fleetwood RV is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact Norcold at 1-800-767-9101.

11V-074

T&E is recalling one recreational vehicle equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. T&E is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact Norcold at 1-800-767-9101.

11V-075

Marathon Homes Corp. (Marathon) is recalling one motorhome, model year 2003 Custom 2 - Room,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2011**

Published February 14, 2011

equipped with a 1200-series Norcold refrigerator. The refrigerator being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Marthon is working with Norcold to identify and notify the affected owner. The owner will be instructed to contact a Norcold dealer to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The safety recall is expected to begin during February 2011. Owners may contact Norcold at 1-800-767-9101.

11V-080

Trail Boss is recalling two horse trailers, model year 2006 Sooner and 2007 Bloomer models, equipped with a 1200-series Norcold refrigerator. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Trail Boss is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The safety recall began on December 16, 2010. Owners may contact Norcold at 1-800-767-9101.

11V-083